AD-A263 230

FINAL REPORT AUGUST 1990

REPORT NO. EVT 14-90

RAIL IMPACT TEST OF ROTARY TOWED SWEEPER



DTIC APR 2 2 1993

Prepared for:

U.S. Army Tank-Automotive Command

ATTN: AMSTA-ISFC Warren, MI 48397-5000

Distribution Unlimited

93-08306

93 4 19 188

VALIDATION ENGINEERING DIVISION SAVANNA, ILLINOIS 61074-9639

U.S. ARMY
ARMAMENT
MUNITIONS
CHEMICAL COMMAND
U.S. ARMY DEFENSE AMMUNITION

CENTER AND SCHOOL

AVAILABILITY NOTICE

A copy of this report will be furnished each attendee on automatic distribution. Additional copies or authority for reprinting may be obtained by written request from Director, U.S. Army Defense Ammunition Center and School, ATTN: SMCAC-DEV, Savanna, IL 61074-9639.

DISTRIBUTION INSTRUCTIONS

Destroy this report when no longer needed. Do not return.

Citation of trade names in this report does not constitute an official endorsement.

The information contained herein will not be used for advertising purposes.

UNCLASSIFIED SECURITY CLASSIFICATION OF THIS PAGE

REPORT DOCUMENTATION				1 PAGE		•	Approved No. 0704-0188		
Ia. REPORT SECURITY CLASSIFICATION				16. RESTRICTIVE MARKINGS					
ι	UNCLAS	SSIFIED			}				
2a. SE	CURITY CL	ASSIFICATION AUT	HORITY		3. DISTRIBUTION	N / AVAILABILITY OF	REPORT	***************************************	
2b. DE	ECLASSIFIC	ATION / DOWNGPA	DING SCHEDULE		UNL	MITED			
4. PEF	RFORMING	ORGANIZATION RE	PORT NUMBER(S)		5. MONITORING	ORGANIZATION RE	PORT NU	MBER(S)	
] 1	EVT 14-9	90							
6a. N/	WE OF PER	FORMING ORGAN	IZATION	6b. OFFICE SYMBOL	7a. NAME OF MO	ONITORING ORGANI	ZATION		
		y Defense An		(if applicable)	TEL TOTAL OF MOTIFICATION OF THE STATE OF TH				
		d School		SMCAC-DEV					
		y, State, and ZIP Co	•		7b. ADDRESS (C	illy, State, and ZIP Co	de)		
ľ		MCAC-DEV							
		IL 61074-96		8b. OFFICE SYMBOL	9 PROCUREMEN	NT INSTRUMENT ID	ENTIFICA	TION NI IN	IRFR
	RGANIZATIO			(If applicable)	J. THOUSILEME	TO THO THOU BY	2.47.11	TION NOW	, oc. i
Ţ	J.S. Am	y Tank-Auton	notive	AMSTA-ISFC	1				
	Comman		d-1	AWSTA-ISIC	10 501/505 05			<u>,, </u>	······
	•	y, State, and ZIP Co.	•		PROGRAM	FUNDING NUMBERS PROJECT NO.	TASK NO) .	WORK UNIT
		AMSTA-ISFC			ELEMENT NO.				ACCESSION NO.
		MI 48397-500			<u> </u>				
11. TI	TLE (Indude	Security Classification	on)						
F	Rail Impa	ct Test of Rot	ary Towed Sv	veeper					
12. PE	RSONAL AL	JTHOR(S)							
	4. C. Mc	* *							
	YPE OF REI		13b. TIME COVER	ED	14. DATE OF REF	PORT (Year, Month, I	Day)	15. PAGE	COUNT
F	Final		FROM -	— то ———	1990	August			
	V	ARY NOTATION			<u> </u>	108 001		<u></u>	
17.		COSATI CODES		18. SUBJECT TERMS	(Continue on revers	e if necessary and ide	entify by bi	ock numbe	er)
F	FIELD	GROUP	SUB-GROUP						
19. AB	STRACT (C	ontinue on reverse il	necessary and iden	tify by block number)					
	The	U.S. Army D	efense Ammu	nition Center and	School (USA	ADACS), Valid	lation E	inginee	ring
I	Divísion ((SMCAC-DE	V), was tasked	by the U.S. Am	ny Tank-Auto	motive Comm	and to	rail imp	pact test
r	Division (SMCAC-DEV), was tasked by the U.S. Army Tank-Automotive Command to rail impact test per MIL-STD-810D, Military Standard Environmental Test Methods and Engineering Guidelines, the								
r	rotary towed sweeper, manufactured by M-B Company, Incorporated, New Holstein, WI. Two								
	MIL-STD-810D rail impact tests were performed on the rotary towed sweeper. While tying down the								
rotary towed sweeper for the first test, the forward tiedown provision bent. This was a failure of the									
provision. The sweeper was sent back to the factory and returned to USADACS on 20 August 1990 for									
retesting. The sweeper was tied to a flatcar with wire rope and subjected to 4, 6, and 8 mph impacts in one									
direction, and then the flatcar was turned 180 degrees and singly impacted at 8 mph. Cable tensions were									
monitored during this test. Tiedown provisions were also statically loaded to verify (continued)									
. .									
20. DI	STRIBUTION	I / AVAILABILITY OF	FABSTRACT		21. ABSTRACT S	ECURITY CLASSIFIC	CATION		
XXUNCLASSIFIED/UNLIMITED SAME AS RPT. DTIC USERS				UNCLA	SSIFIED				
	22a. NAME OF RESPONSIBLE INDIVIDUAL					(Indude Area Code))	22c. OFF	TICE SYMBOL
l J	JEROME H. KROHN				815-273	-8929		SMC	CAC-DEV

19. ABSTRACT (continued)

conformance with MIL-STD-209G, Military Standard Slinging and Tiedown Provisions for Lifting and Tying Down Military Equipment. Results of these tests are included in this report. The rotary towed sweeper passed all rail impact tests.

DIIC QUALITY I	Live Comment
----------------	---------------------

Acces	ion Fo	r			
MTIS	GRALI	G	3		
DTIC :	TAB		ם ו		
Unann	because		ב (
Justin	ficatio	ــــــــــــــــــــــــــــــــــــــ			
Avai	ibution	y Code			
Avail and/or Bist Special					
P.I					

U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL VALIDATION ENGINEERING DIVISION SAVANNA, IL 61074-9639

REPORT NUMBER EVT 14-90

RAIL IMPACT TEST OF ROTARY TOWED SWEEPER

AUGUST 1990

TABLE OF CONTENTS

PART	PAGE NO
1. INTRODUCTION	
A. BACKGROUND	1-1
B. AUTHORITY	1-1
C. OBJECTIVE	1-1
D. CONCLUSION	1-1
2. ATTENDEES	2-1
3. TEST PROCEDURES	3-1
4. TEST RESULTS	4-1
5. PHOTOGRAPHS	5-1
6. TEST DATA	6-1

PART 1

INTRODUCTION

- A. BACKGROUND. The U.S. Army Defense Ammunition Center and School (USADACS), Validation Engineering Division (SMCAC-DEV), was tasked by the U.S. Army

 Tank-Automotive Command to rail impact test the rotary towed sweeper, manufactured by

 M-B Company, Incorporated, New Holstein, WI. Two MIL-STD-810D, Military Standard

 Environmental Test Methods and Engineering Guidelines, rail impact tests were performed on the rotary towed sweeper. While tying down the sweeper for the first test, the forward tiedown provision bent. This was a failure of the provision. The sweeper was sent back to the factory and returned to USADACS on 20 August 1990 for retesting. The sweeper was tied to a flatcar with wire rope and subjected to 4, 6, and 8 mph impacts in one direction, and then the flatcar was turned 180 degrees and singly impacted at 8 mph. Cable tensions were monitored during this test. Tiedown provisions were also statically loaded to verify conformance with

 MIL-STD-209G, Military Standard Slinging and Tiedown Provisions for Lifting and Tying Down Military Equipment.
- B. <u>AUTHORITY</u>. This test was conducted IAW mission responsibilities delegated by U.S. Army Armament, Munitions and Chemical Command (AMCCOM), Rock Island, IL 61299-6000. Reference is made to Change 4, 4 October 1974, to AR 740-1, 23 April 1971, Storage and Supply Operations; AMCCOMR 10-17, 13 January 1986, Mission and Major Functions of U.S. Army Defense Ammunition Center and School.
- C. <u>OBJECTIVE</u>. The objective of this test was to determine if the rotary towed sweeper meets the test requirements of MIL-STD-810D and MIL-STD-209G.

D. <u>CONCLUSION</u>. The rotary towed sweeper was tested twice. The first rail impact test resulted in a deformed tiedown provision. For the second test with a redesigned tiedown provision, the rotary towed sweeper passed the MIL-STD-810D rail impact test and the test requirements of MIL-STD-209G.

PART 2

ATTENDEES

1 AND 21 AUGUST 1990

A. C. McIntosh

General Engineer DSN 585-8989

815-273-8989

Jerome H. Krohn

Supervisory General Engineer

DSN 585-8908 815-273-8908

Quinn D. Hartman

General Engineer DSN 585-8992

815-273-8992

William R. Meyer

General Engineer

DSN 585-8090

815-273-8090

Ralph Amold

Industrial Engineering Technician

DSN 585-8073

815-273-8073

Mike Cochrane

DSN 927-4046

804-599-4046

Director

U. S. Army Defense Ammunition Center

and School

ATTN: SMCAC-DEV

Savanna, IL 61074-9639

Director

U. S. Army Defense Ammunition Center

and School

ATTN: SMCAC-DEV

Savanna, IL 61074-9639

Director

U. S. Army Defense Ammunition Center

and School

ATTN: SMCAC-DEV

Savanna, IL 61074-9639

Director

U. S. Army Defense Ammunition Center

and School

ATTN: SMCAC-DEV

Savanna, IL 61074-9639

Director

U. S. Army Defense Ammunition Center

and School

ATTN: SMCAC-DET

Savanna, IL 61074-9639

Commander

Military Traffic Management Command,

Transportation Engineering Agency

ATIN: MTTE-TRV

Newport News, VA 23606-0276

Rick Sauer 414-898-4203 M-B Company, Incorporated 1615 Wisconsin Avenue

P.O. Box 200

New Holstein, WI 53601

Ken Schneider 414-898-4203 M-B Company, Incorporated 1615 Wisconsin Avenue

P.O. Box 200


New Holstein, WI 53601

PART 3

TEST PROCEDURES

A. Rail Impact Test.


- 1. Test Load (specimen). The rotary towed sweeper test load was prepared for rail testing IAW manufacturer's instructions. The sweeper was then loaded onto the railroad flatcar and, using the blocking and bracing methods specified in the outloading procedures in figures 1 and 2, secured to the flatcar. The railcar used in the test was inspected to ensure its adequacy for transportation.
- 2. Rail Impact Procedure. The test load was positioned on a railcar. Equipment needed to perform the test included the specimen (hammer) car, five empty railroad cars connected together to serve as the anvil, and a railroad locomotive (figure 3). These anvil cars were positioned on a level section of track with air and hand brakes set and with the draft gears compressed. The locomotive unit pulled the specimen car several hundred yards away from the anvil cars, then pushed the specimen car toward the anvil at a predetermined speed, and disconnected from the specimen car approximately 50 yards away from the anvil cars. This allowed the specimen car to roll freely along the track until it struck the anvil. This constituted an impact. Impacting is accomplished at speeds of 4, 6, and 8 mph in one direction and at a speed of 8 mph in the opposite direction. The 4 and 6 mph impact speeds are approximate; the 8 mph speed is a minimum. Impact speeds are to be determined by using an electronic counter to measure the time required for the specimen car to traverse an 11-foot distance immediately prior to contact with the anvil cars.

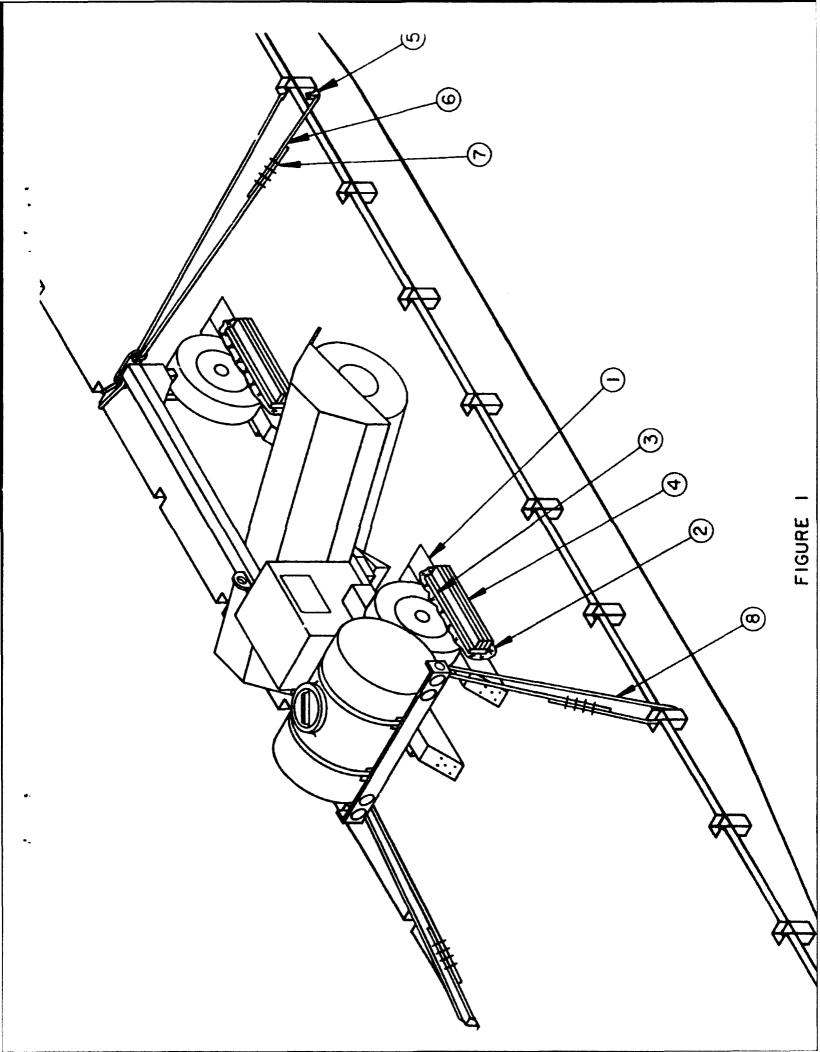

KEY NUMBERS

- (1) CHOCK BLOCK (6 REQUIRED). 24" LONG BY 6" WIDE BY 8" HIGH. LOCATE 45 DEGREE END OF BLOCK AGAINST WHEEL. NAIL THROUGH HEEL OF BLOCK W/3-40d NAILS AND 2-60d NAILS. NAIL EACH SIDE TO THE CAR FLOOR W/2-40d NAILS.
- 2 ANTI-CHAFING WATER-PROOF PAPER OF A SUFFICIENT SIZE TO POSITION UNDER AND EXTEND 2" ABOVE PIECE MARKED (3).
- (3) RUBBING STRIP, 2" BY 6" BY 30" (4 REQUIRED). POSITION ON EDGE AND NAIL TO LOWER PIECE MARKED 4 W/1-12d NAIL EVERY 8".
- 4 SIDE BLOCKING, 2" BY 4" BY 30" (TRIPLED) (4 REQUIRED). NAIL FIRST PIECE TO CAR FLOOR W/1-20d NAILS, EVERY 8". NAIL EACH ADDITIONAL PIECE IN THE SAME MANNER.
- (5) THIMBLE, STANDARD, SIZE 3/8" (8 REQUIRED). USE ONE PER STAKE POCKET AND ONE PER LADING TIE-DOWN AND/OR LIFTING DEVICE.
- 6 FRONT TIEDOWN, 3/8" DIAMETER STEEL WIRE ROPE, 24'-0" LONG (2 REQUIRED). INSTALL THE CABLE ANGULARLY, AS SHOWN, TO FORM A COMPLETE LOOP FROM THE STAKE POCKET ON THE CAR TO THE LADING TIEDOWN DEVICE AND BACK TO THE STAKE POCKET.
- (7) CLIP, SIZE 3/8" (16 REQUIRED). APPLY FOUR CLIPS PER CABLE JOINT.
- 8 REAR TIE-DOWN, 3/8" DIAMETER STEEL WIRE ROPE, 18'-0" LONG. SECURE IN THE SAME MANNER AS PIECE MARKED (6).

ASSOCIATION OF AMERICAN RAILROADS (AAR) STANDARD TEST PLAN

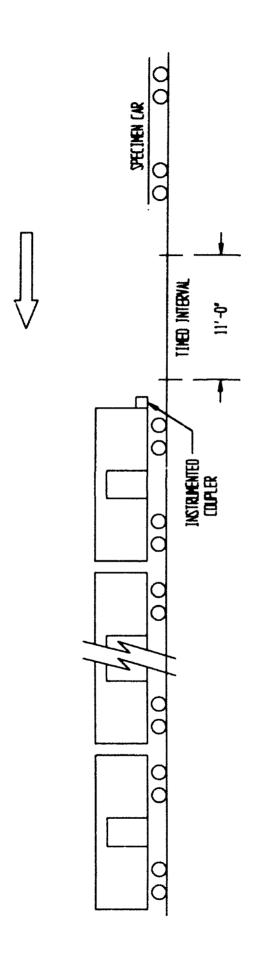

5 BUFFER CARS (ANVIL) WITH DRAFT GEAR COMPRESSED AND AIR BRAKES IN A SET **POSITION** ANVIL CARS TOTAL WT 250,000 LBS (APPROX)

SWITCH ENGINE TO IS RELEASED BY SPECIMEN CAR

ATTAIN: IMPACT NO. 1 @ 4 MPH

IMPACT NO. 3 @ 8 MPH

IMPACT NO. 2 @ 6 MPH

RELEASED BY SWITCH ENGINE TO THEN THE CAR IS REVERSED AND

ATTAIN: IMPACT NO 4. @ 8 MPH

B. Securing Provision Tests - MIL-STD-209G.

- 1. <u>Tiedown Provisions</u>. Class 2 provisions withstood 4.0 times the maximum shipping weight (MSW) in the fore-and-aft direction of the longitudinal axis of the equipment, 2.0 times the MSW in the downward direction of the vertical axis, and 1.5 times the MSW in each direction of the lateral axis. The force applied to each provision was its proportionate share of the MSW. Each load was maintained for a period of not less than 90 seconds. A suitable measuring device (dynamometer or load cell) was placed between the provision and the applied force.
- 2. Slinging Provisions. The MSW of the rotary towed sweeper is 2,170 pounds. A design load of 2.3 times the working load of each provision is required. The test load was applied to the lifting provision for a period of 90 seconds. A suitable measuring device (dynamometer or load cell) was placed between the provision and the applied force. Test load calculations are shown in figures 4 and 5.

M874 ROTARY TOWED SWEEPER

REAR LIFT PROVISION

DESIGN LOADS

1. DISTANCE FROM FRONT PROVISIONS TO REAR PROVISIONS ALONG CENTERLINE:

96.25 INCHES.

2. DISTANCE FROM FRONT PROVISIONS TO CENTER OF GRAVITY:

90.62 INCHES.

- 3. GROSS VEHICLE WEIGHT: 2,140 POUNDS.
- 4. VERTICAL FORCE COMPONENT AT REAR PROVISIONS:


$$V_r = (90.62) (2.140 LBS.)$$
 = 2,024.24 POUNDS

- 5. VERTICAL FORCE IS SHARED BY TWO PROVISIONS: 2,024.24/2 = 1,012.12 POUNDS.
- 6. RESULTANT FORCE COMPONENT AT 45 DEGREES:

$$R_r = (1.012.12)$$

cosine 45° = 1,431.35 POUNDS

- 7. DESIGN LOAD = (1,431.35)(3.2) = 4,580.3 POUNDS.
- 8. EACH REAR PROVISION SHOULD BE PULLED AT 45 DEGREES AND HELD AT 4,580 POUNDS FOR 90 SECONDS.

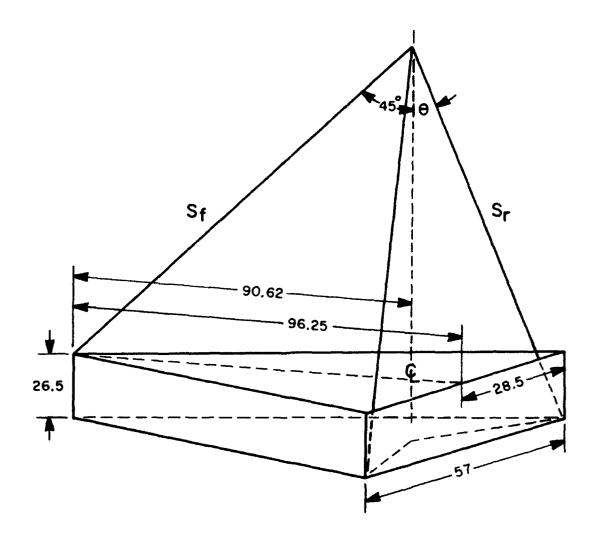

Sf = 128.2 inches

Sr = 120.7 inches

Apex height = 117.1 inches from base of figure

 $\theta = 14.1$ degrees

PART 4

TEST RESULTS

TEST SPECIMEN AND RESULTS

RAIL IMPACT DATA

Test No.: 1

Load No.:

Date: 1 August 1990

Specimen Load: Rotary Towed Sweeper

Flatcar No.: BN 603022

Lt. Wt.: 55,500 lbs.

Load Type: Rotary Towed Sweeper

Wt.: 2,150 lbs.

Total Specimen Wt.:

57,650 lbs.

Buffer Car (five cars) Wt.: 250,000 lbs.

		Velocity	
Impact	End Struck	(MPH)	Remarks:
1	Towed End	4.9	No load movement.
2	Towed End	6.46	Rear tiedown spread 1/4-inch.
3	Towed End	8.62	Rear tiedown spread an additional 1/8-inch.
4	Tank End	8.56	No additional damage.

The rotary towed sweeper failed rail impact testing. The rear tiedown provision deformed. It was recommended that the tiedown provision be strengthened.

TEST SPECIMEN AND RESULTS

RAIL IMPACT DATA

Test No.: 2

Load No.:

Date: 21 August 1990

Specimen Load: Rotary Towed Sweeper

Flatcar No.: BN 603022

Lt. Wt.: 55,500 lbs.

Load Type: Rotary Towed Sweeper

Wt.:

2,150 lbs.

Total Specimen Wt.:

57,650 lbs.

Buffer Car (five cars) Wt.: 250,000 lbs.

		Velocity	
Impact	End Struck	(MPH)	Remarks:
1	Towed End	4.15	No load movement.
2	Towed End	6.35	No load movement.
3	Towed End	8.62	No load movement.
4	Tank End	8.52	No load movement.


The rotary towed sweeper passed rail impact testing.

MIL-STD-209G pull test of rear provisions. Each provision was pulled to 5,000 pounds and held for a period of 90 seconds. No deformation to the tiedown provisions was observed.

Rotary Towed Sweeper

Tiedown Cable Tension

21 August 1990

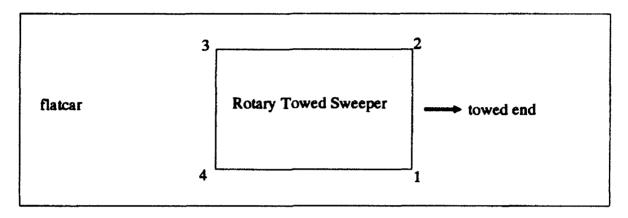


The diagram shows a layout of the rotary towed sweeper positioned on a flatcar. Nos. 1 - 4 label each tiedown cable that secured the sweeper to the flatcar. Cable tension was measured after each impact and is recorded below.

Impact/Cable	_1_	_2_	_3_	_4_
0	2,600	2,000	1,250	1,300
1	1,350	1,220	1,120	1,110
2	1,100	1,050	1,040	1,070
3	1,050	1,100	880	950
4	800	800	950	1,060

Impact 0 is the tension on each cable before rail impacting the rotary towed sweeper. Impacts nos. 1 - 3 were in the towed direction, impact no. 4 was in the reverse direction. The decrease in cable tension with successive impacts was attributed to the cables cutting into the wooden flatcar deck from the jerk occurring with each impact.

PART 5

PHOTOGRAPHS

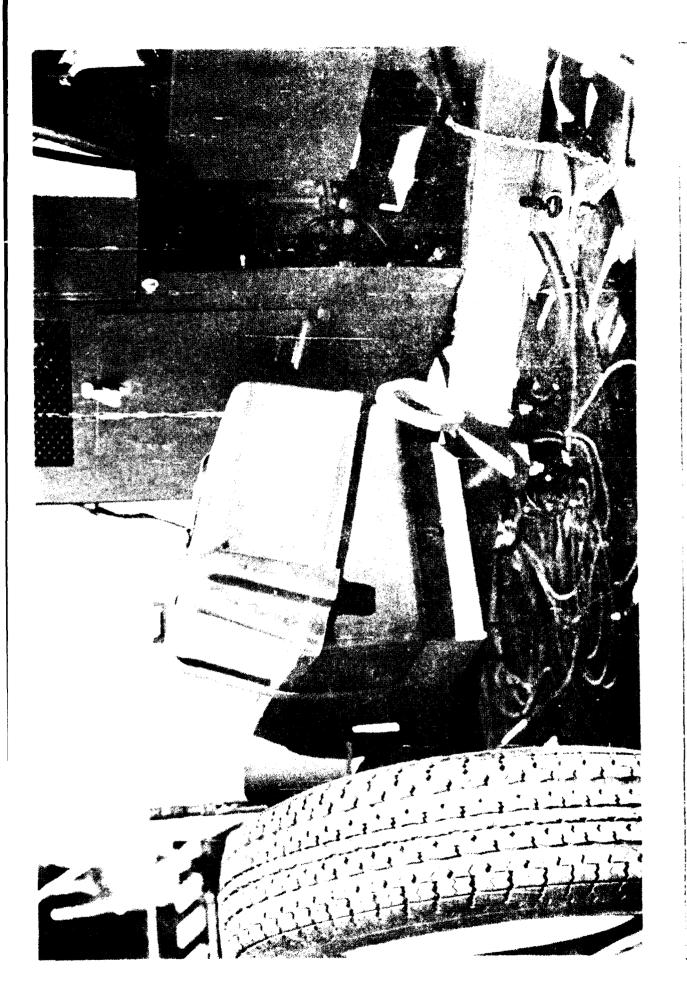

U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo No. A0317-SPN-90-328-3905. This photo shows the rotary towed sweeper battery case after a rail impact Tightening the battery case cover strap did not improve holding the cover in its operating position.


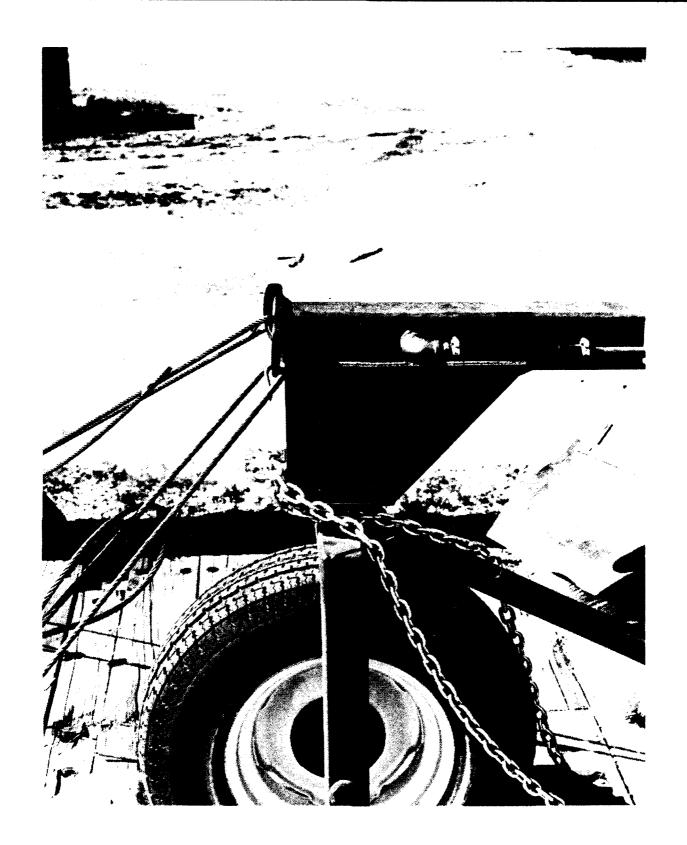


Photo No. A0317-SPN-90-328-3906. This photo shows the forward tiedown provisions on the towed end of the rotary towed sweeper. Note the deformation of the tiedown. Initial deformation occurred during equipment tie-down. Additional deformation occurred during rail impact testing.



Photo No. A0317-SPN-90-328-3910. This photo shows the rear tiedown fitting on the rotary towed sweeper. Wire cable is used to secure the sweeper to the railcar. Note the wheel blocking.

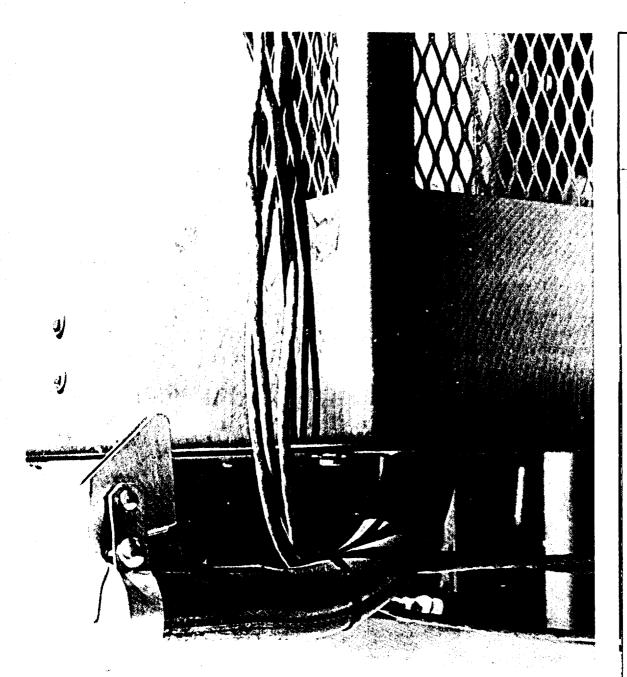


sweeper. The water tank is to the rear. To access the engine compartment from this side, the metal panel through which the exhaust protrudes must be removed. The wires attached to the exhaust are for test instrumentation and Photo No. A0317-SPN-90-328-3912. This photo shows the exhaust stack from the engine of the rotary towed are not a part of the sweeper.



U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo No. A0317-SPN-90-328-3914. This photo shows a top view of the rear tiedown provision on the rotary towed A 3/8-inch cable is used to tie the sweeper to the railcar. Note the set hand brake at the left. sweeper.

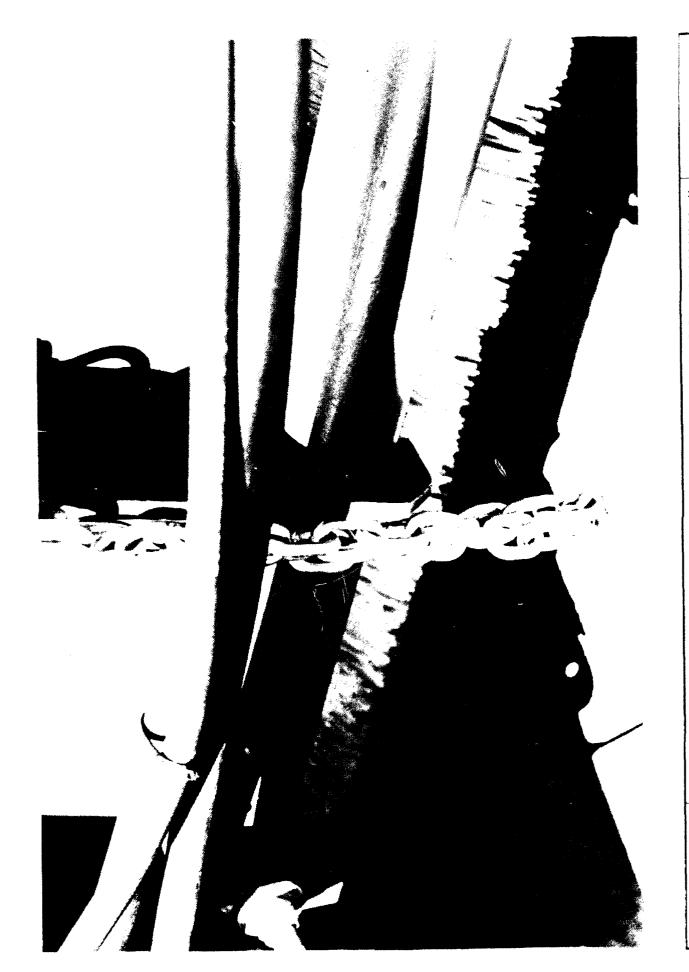

U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo No. A0317-SPN-90-328-3919. This photo shows the hydraulic power lines and method of securement at the rear of the broom shield. The chain is used to maintain the broom direction (sweep to the right or left) when in use.

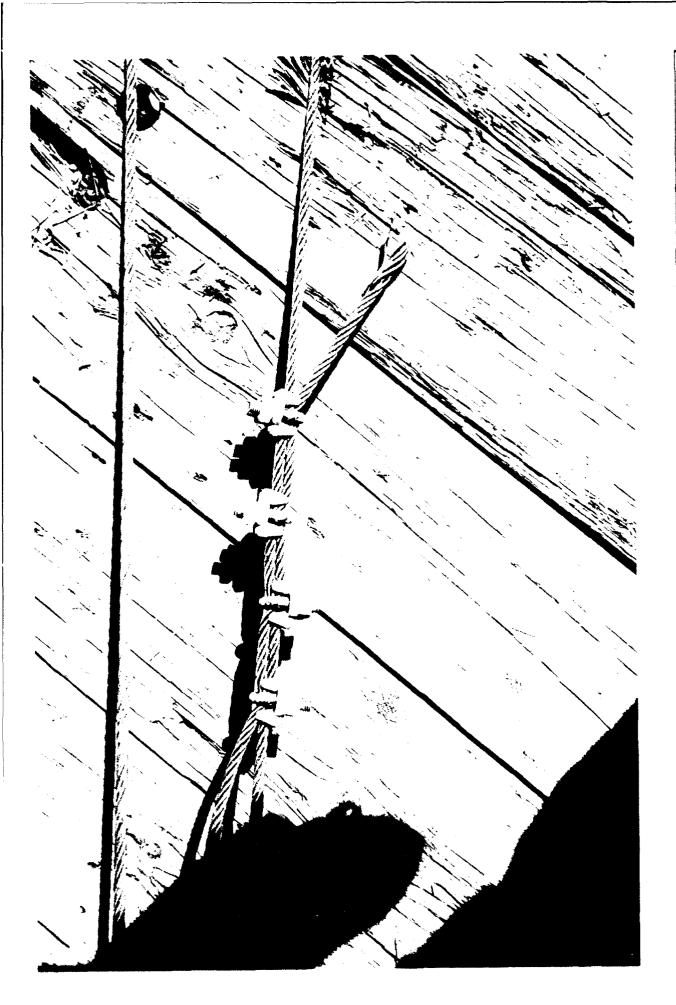
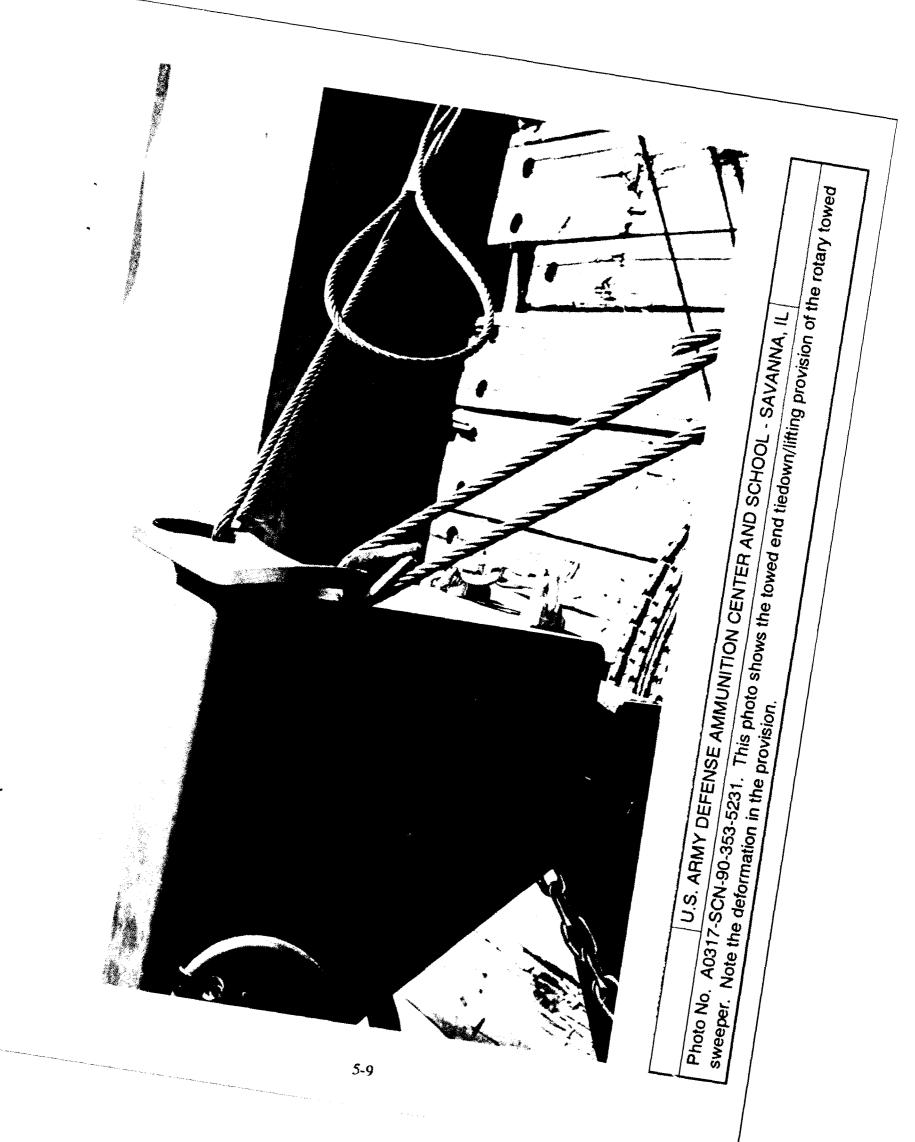


Photo No. A0317-SCN-90-353-5220. This photo shows the cable configuration used in securing the rotary towed sweeper for rail transportation.



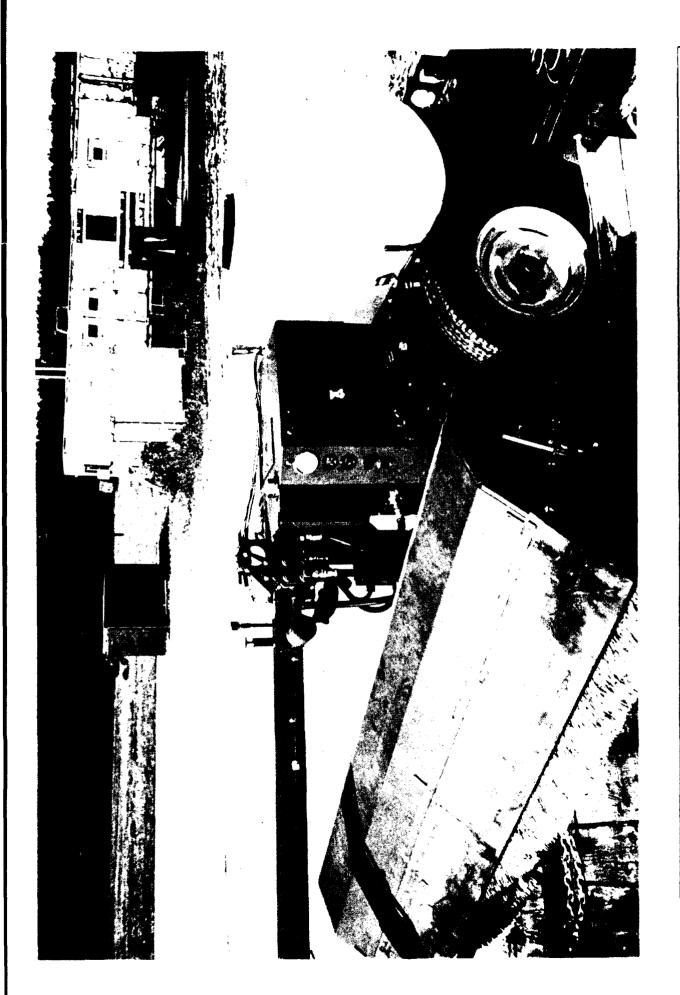


Photo No. A0317-SCN-90-353-5234. This photo shows a side view of the rotary towed sweeper. The brush is at the left, control panel in the center, and the water tank at the right. Note the wheel side blocking.



Photo No. A0317-SCN-90-353-5236. This photo shows a rear view of the rotary towed sweeper. Note the taut tiedown cables holding the sweeper to the railcar. Data recording instrumentation is in the foreground.

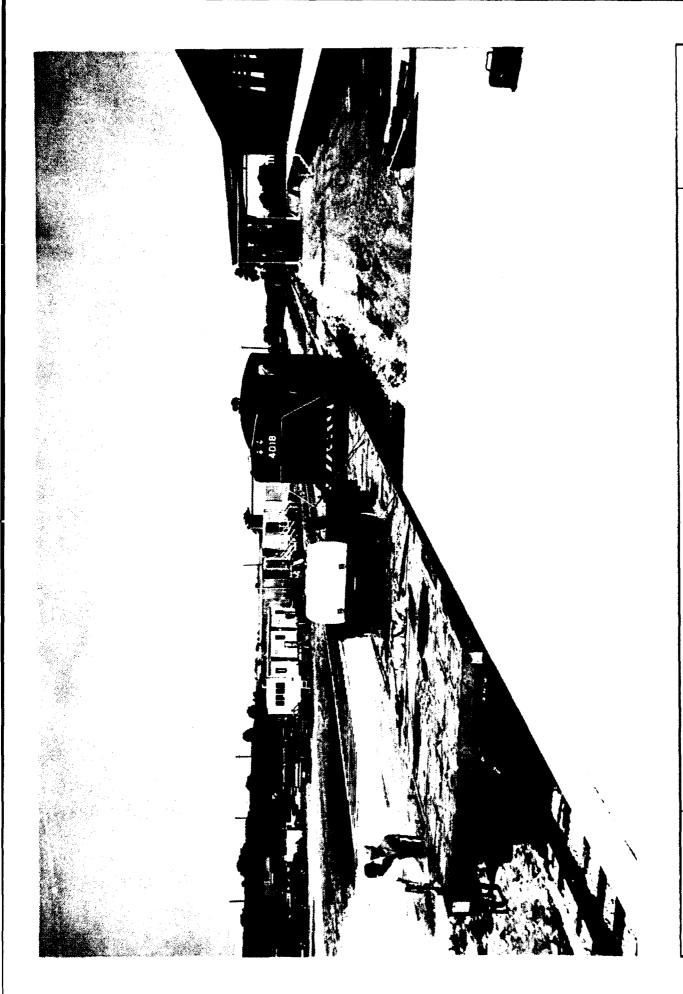


Photo No. A0317-SCN-90-353-5242. This photo shows the rotary towed sweeper moving down the rails just prior to impact. U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

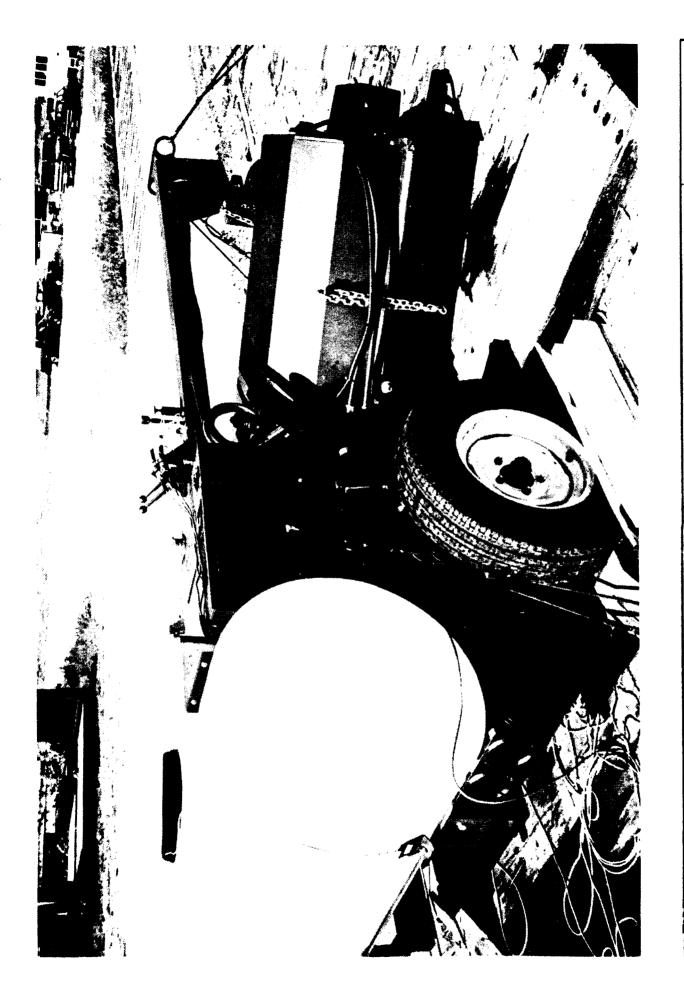


Photo No. A0317-SCN-90-353-5245. This photo shows a side view of the rotary towed sweeper. Note the wheel blocking and bracing.

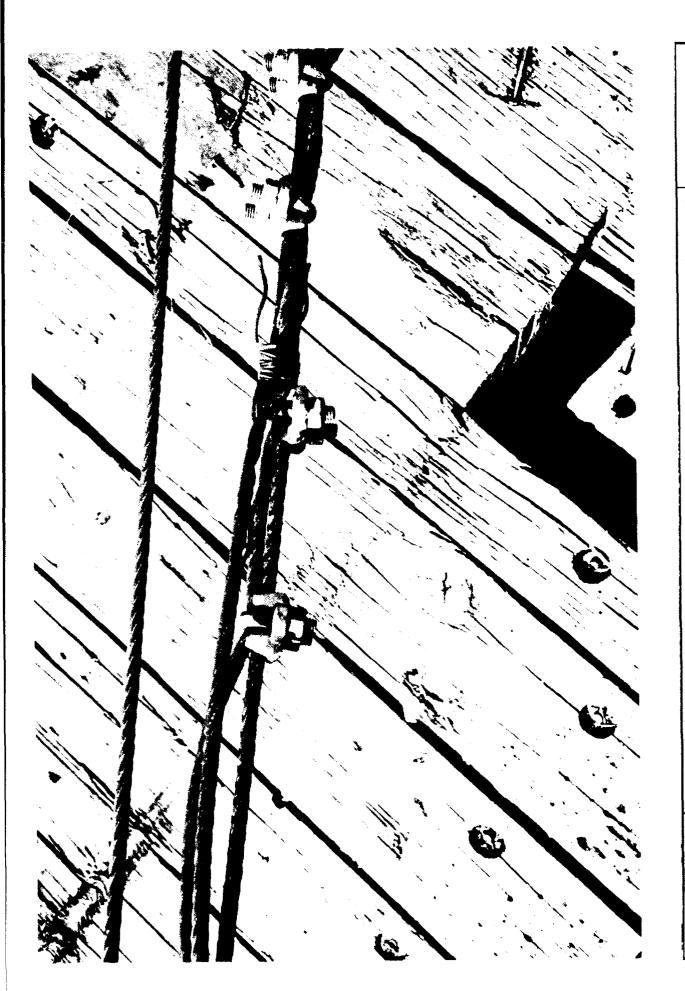


Photo No. A0317-SCN-90-353-5249. This photo shows the method of securing the tiedown cables used during the rotary towed sweeper test. Note the condition of the floor of the flatcar.

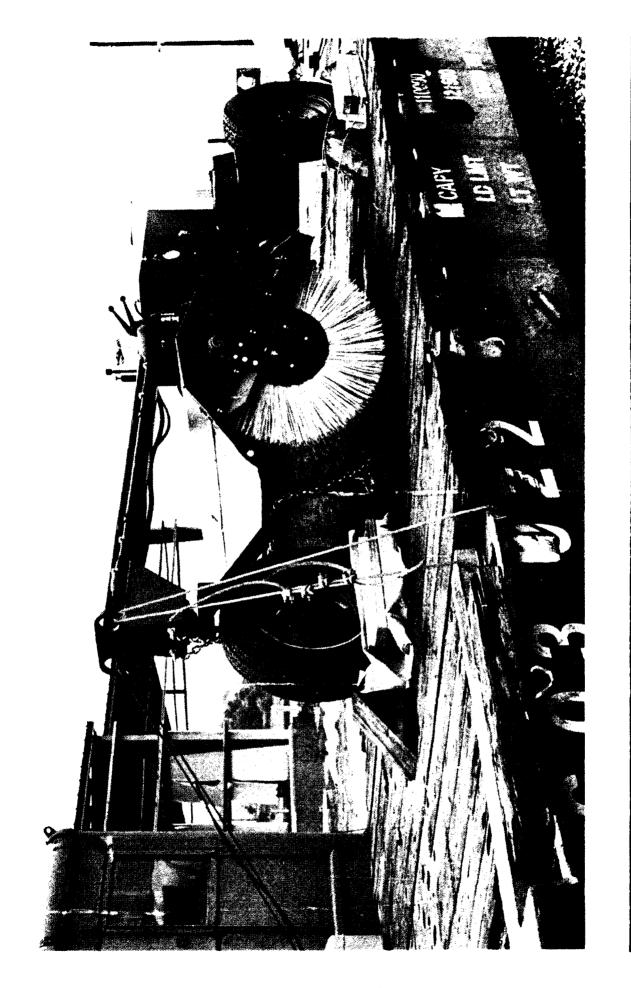


Photo No. A0317-SPN-90-353-5279. This photo shows the rotary towed sweeper blocked, braced, and tied down to a flatcar ready for rail impact testing. What appears to be a half-filled water tank is the tank mold mark. The 250-gallon tank was empty during testing.

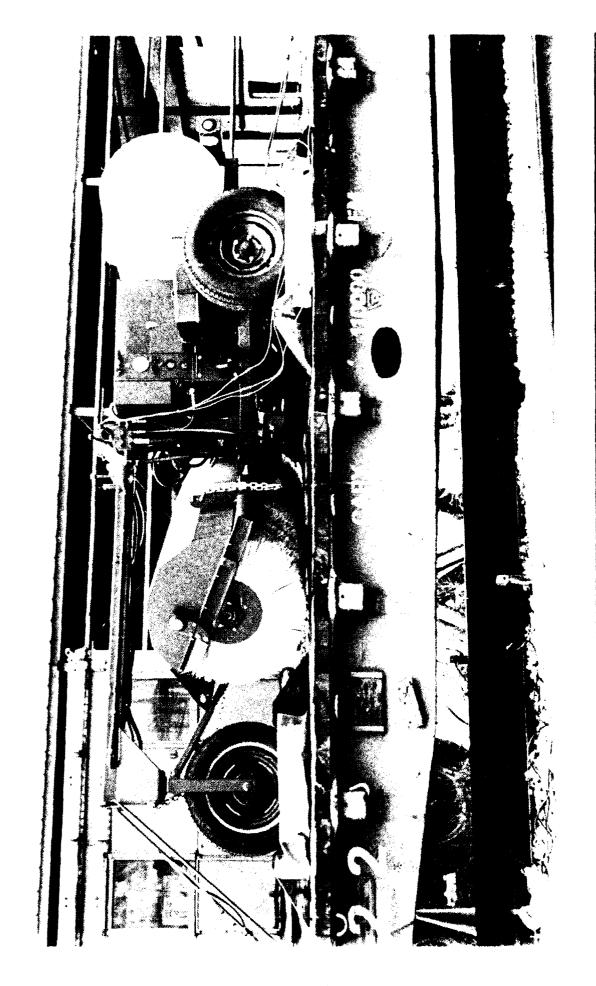


Photo No. A0317-SPN-90-353-5278. This photo shows the rotary towed sweeper blocked, braced, and tied down to a flatcar ready for rail impact testing.


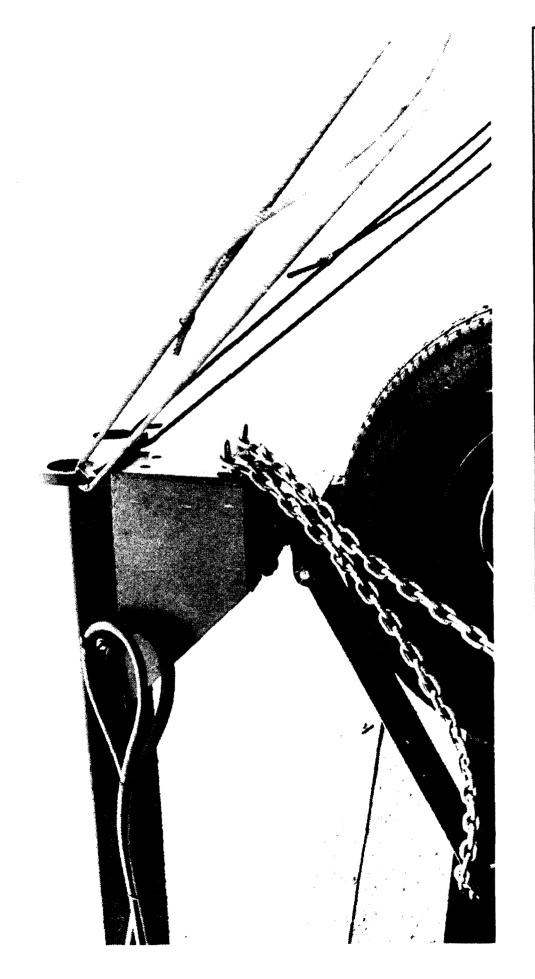


Photo No. A0317-SPN-90-353-5277. This photo shows the rotary towed sweeper's towed end tiedown provision with tiedown cables used to secure it to a flatcar.



Photo No. A0317-SPN-90-353-5276. This photo shows the wheel blocking and bracing used to keep the rotary towed sweeper from moving during rail transportation.

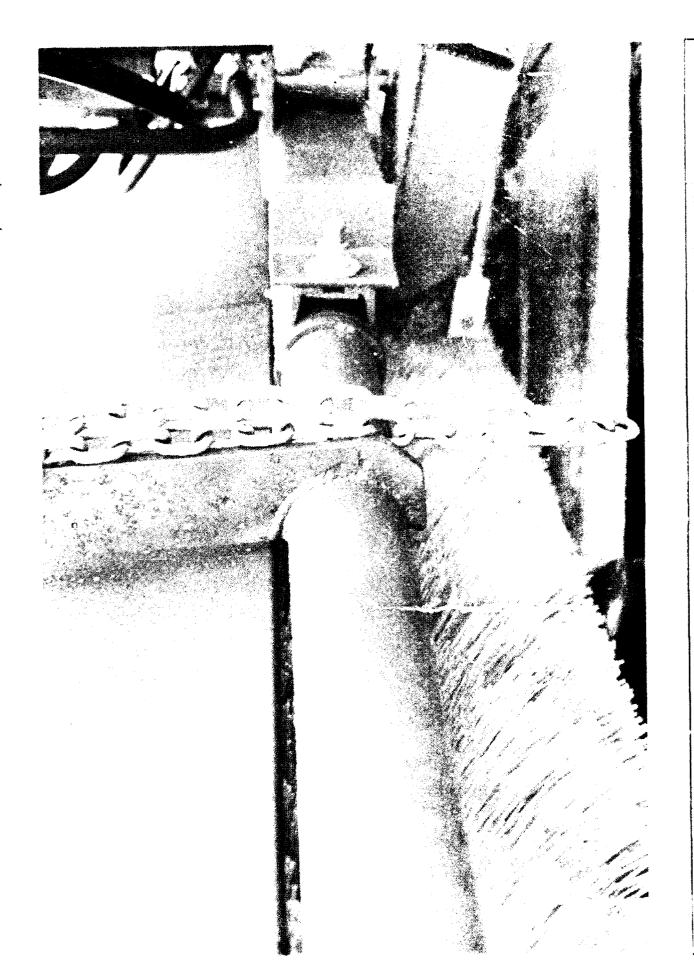

U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo No. A0317-SPN-90-353-5280. This photo shows a chain used in restraining the rotary towed sweeper broom. This chain remains free to move during transportation.


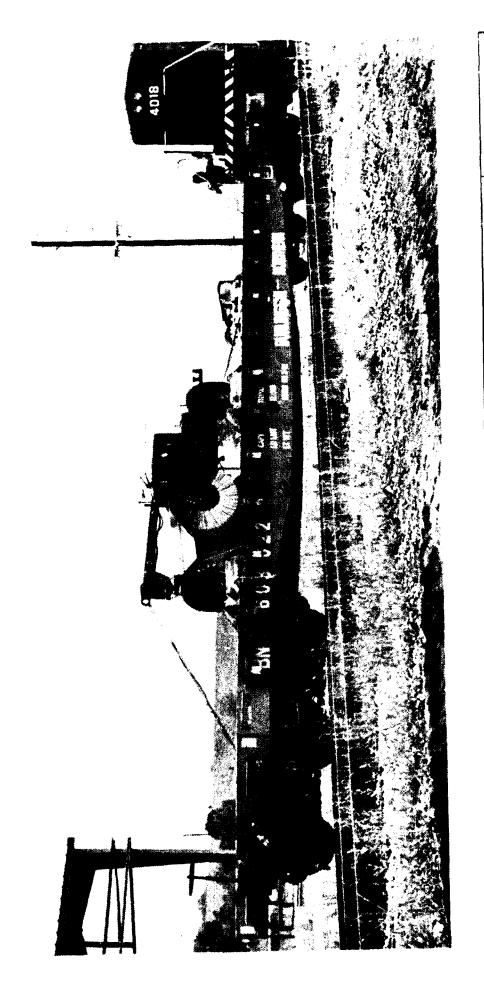


Photo No. A0317-SPN-90-353-5281. This photo shows the rotary towed sweeper blocked, braced, and tied down to a flatcar ready for rail impact testing.



Photo No. A0317-SPN-90-353-5284. This photo shows a tiedown provision on the rear of the rotary towed sweeper with a cable securing it to a flatcar. Note the wheel chocks and side bracing with anti-scuff material.

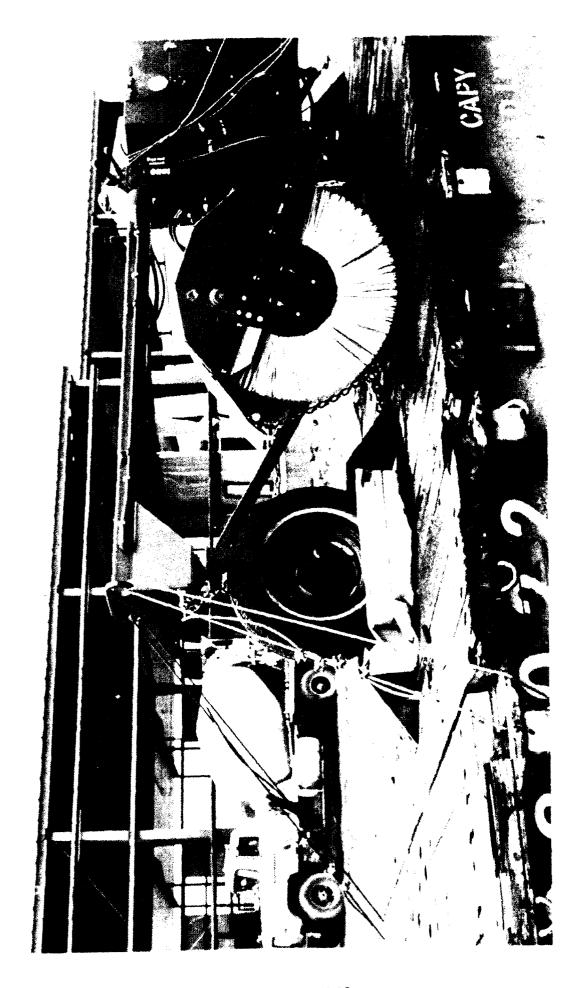

sweeper to a flatcar for rail transportation. Note the front wheel chocks and side bracing. The towing tongue is Photo No. A0317-SPN-90-353-5293. This photo shows the front tie-downs used to secure the r tary towed secured under the brush.


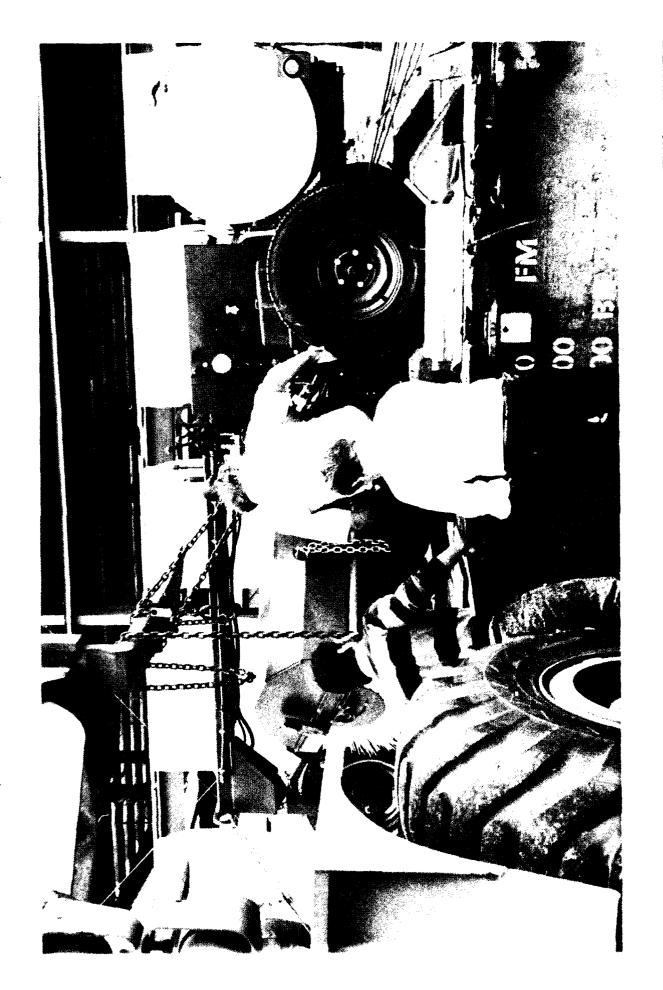


Photo No. A0317-SPN-90-353-5302. This photo shows the procedure used to test the load capability of the slinging provisions on the rotary towed sweeper. Representatives from USADACS, MTMC-TEA, and the manufacturer are monitoring the test.

PART 6


TEST DATA

6000.1 X 2.2 mi

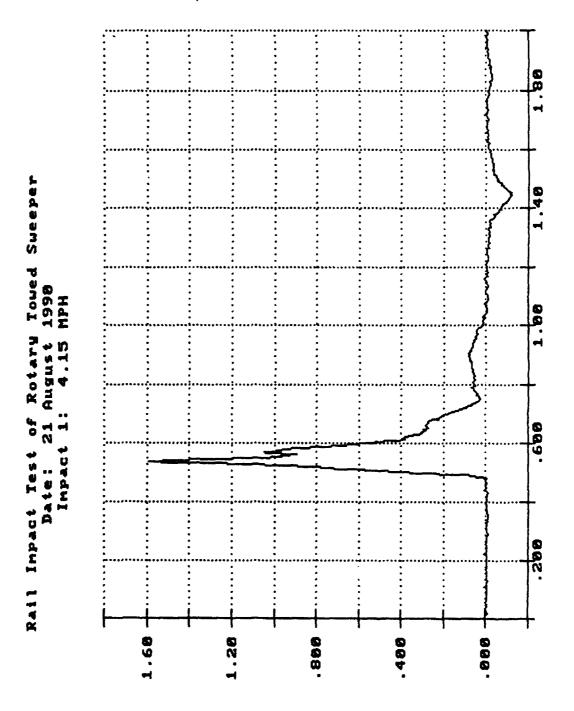

Sample Time in Seconds


6000.1 X 2'2 mi

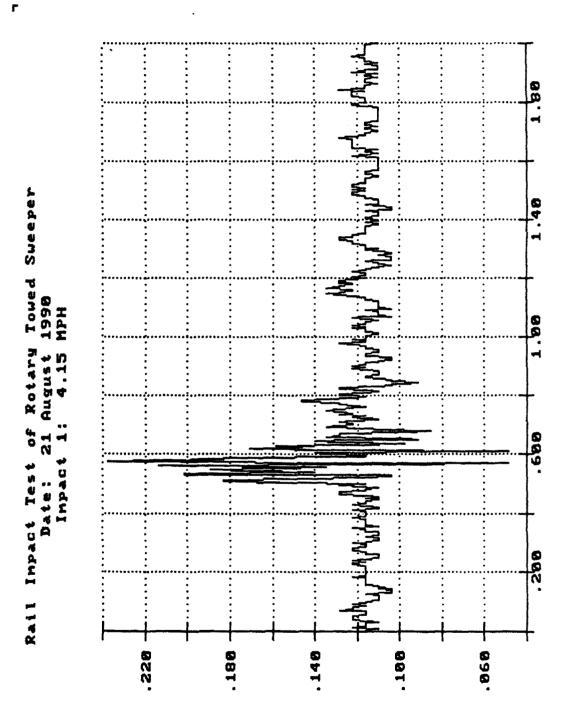

Sanple Time in Seconds

filz no moiteralabaA

th G.S X 0000 T

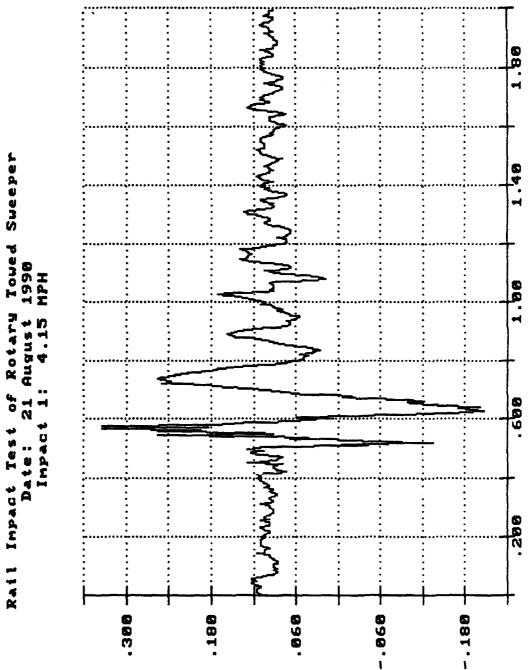


Sample Tine in Seconds

Г

x 1.8888

8888.88881 X 28888.8888

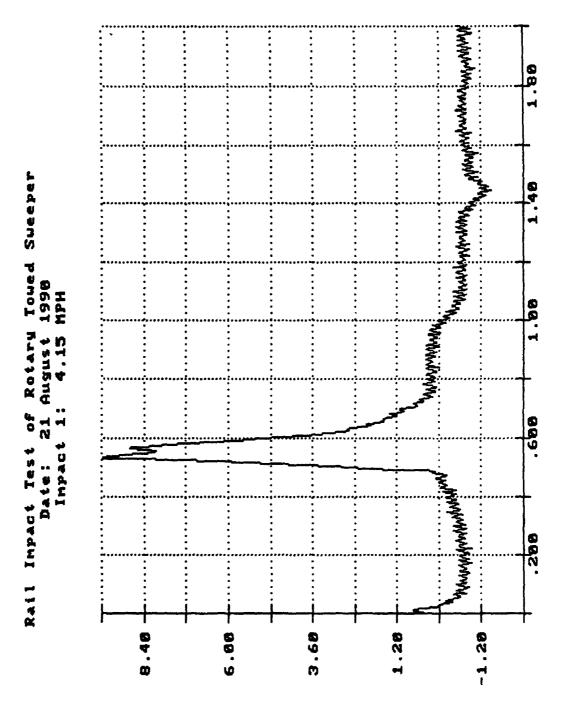


r

Sample Time in Seconds


Longitudinal Acceleration on Franc

12 C.S X 1.0000

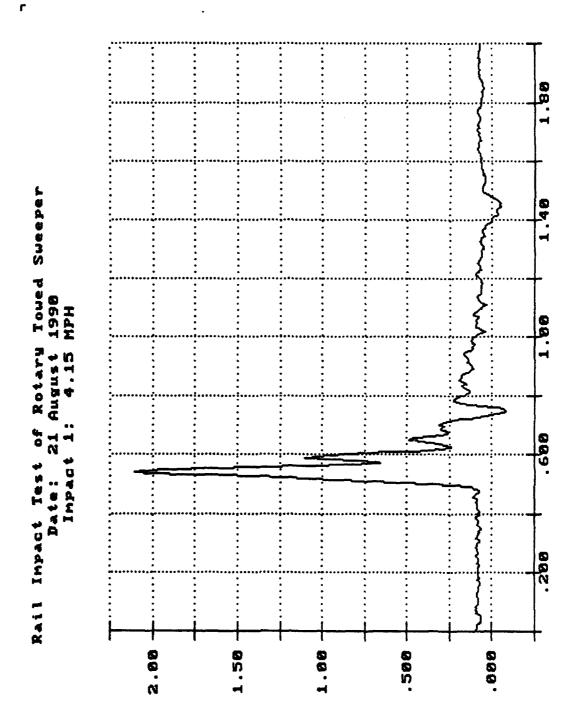

Sample Time in Seconds

in G'S X 1,0866

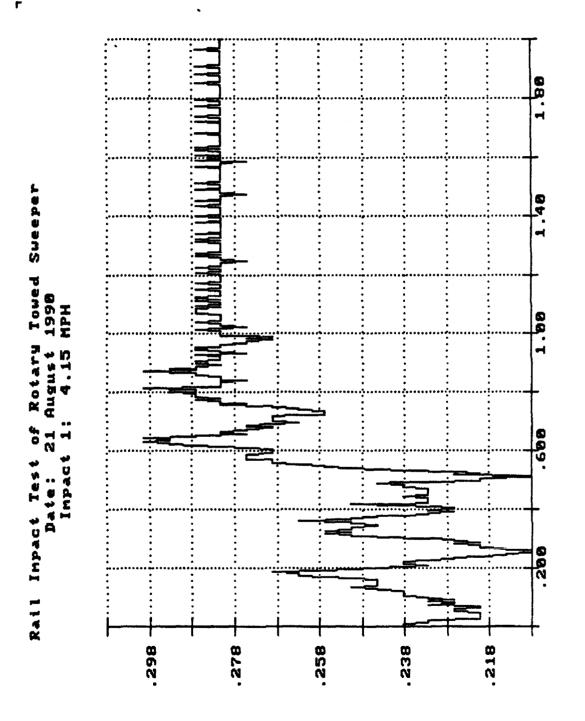


Sample Time in Seconds

Acceleration on Frame

n i 0000 T


IssitraV

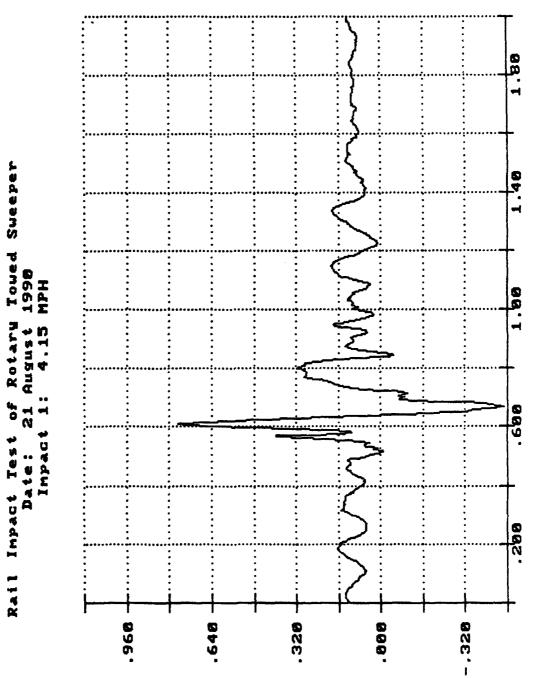

Sample Time in Seconds

x 1.8888


noitarsisonA

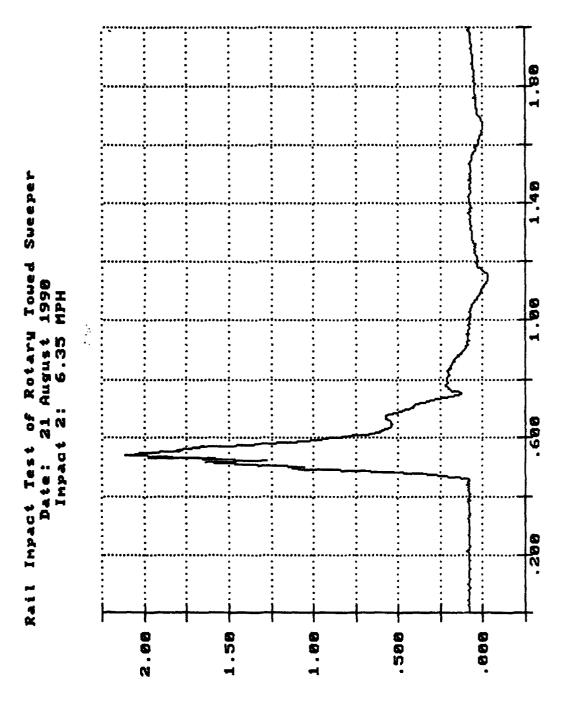

llis uo


Sample Tine in Seconds

1n G'S X 1.8888

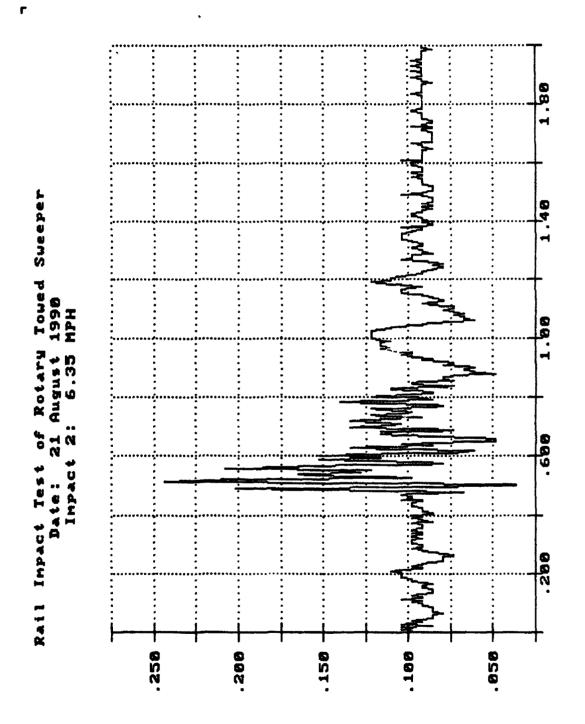

Sample Time in Seconds

9899'T X S.5 u

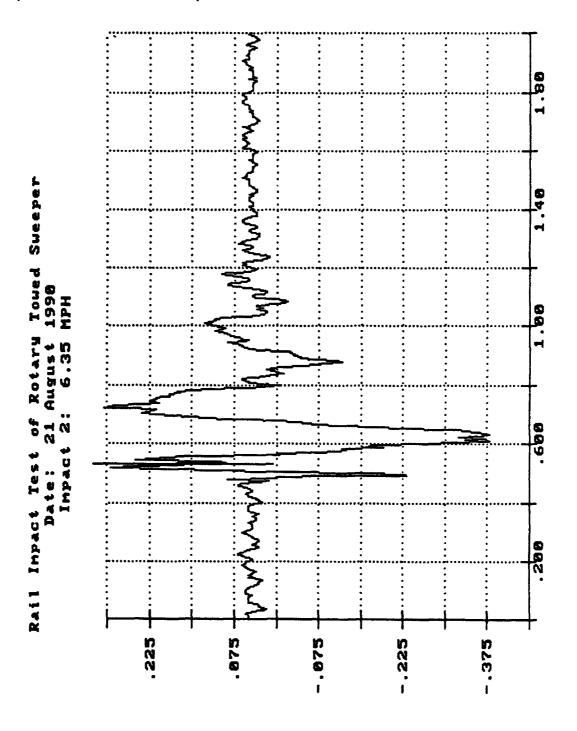

Sample Tine in Seconds


6666.666661 X zbnuoq ni

igernostratorio interestata de la capación de la ca 1.88 Sweeper 1.48 Towad 1998 HAH 99. Rotary 6.35 Augus t Jate: 21 Impact 2: 699 Rail Impact Test Date: Warey Marie Constitution of the Constitution o 288 1.28 .968 .640 .320 . 888

r


Sample Tine in Seconds

12 C'S X 1.6666

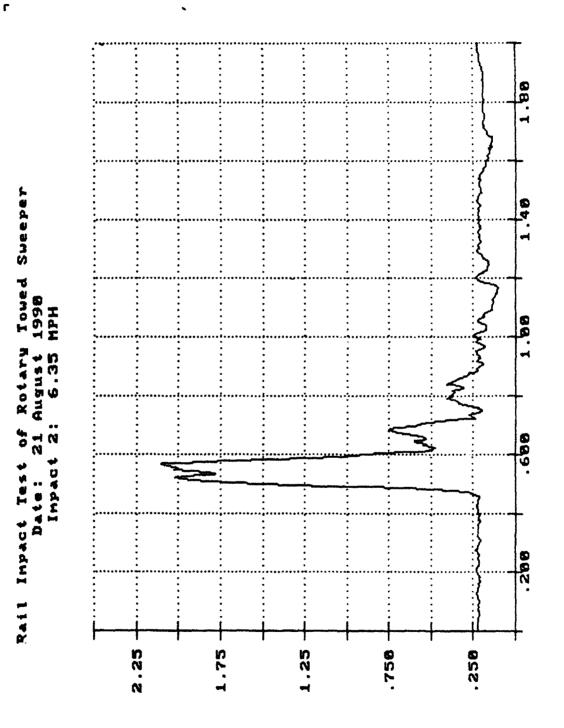


Sample Time in Seconds

1 C. 2 X T'8888

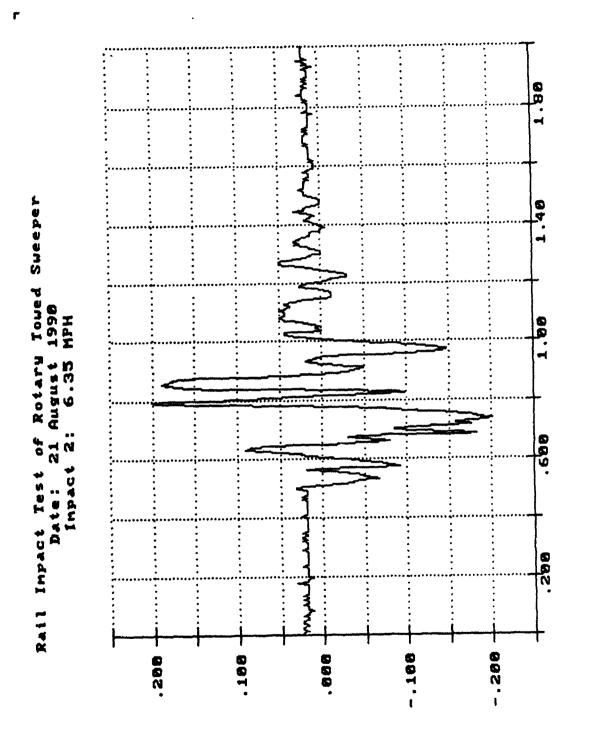

Sample Time in Seconds


12 C.2 X T'0000

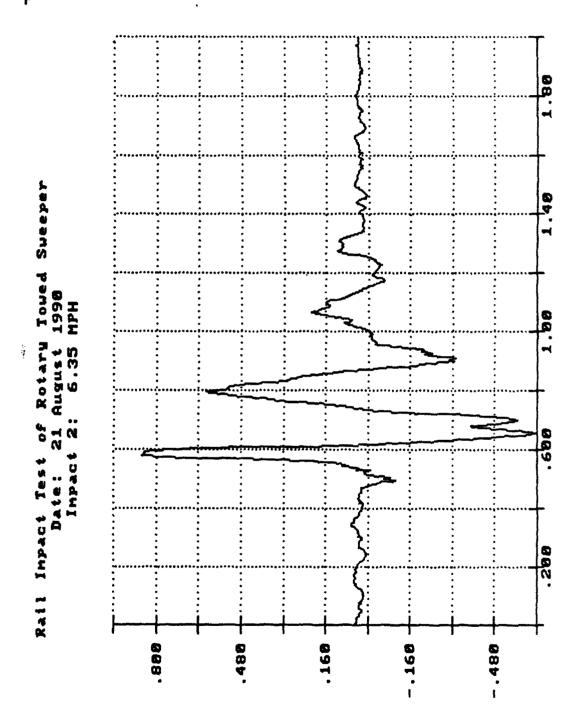

Sample Time in Seconds


×

Acceleration on Sill

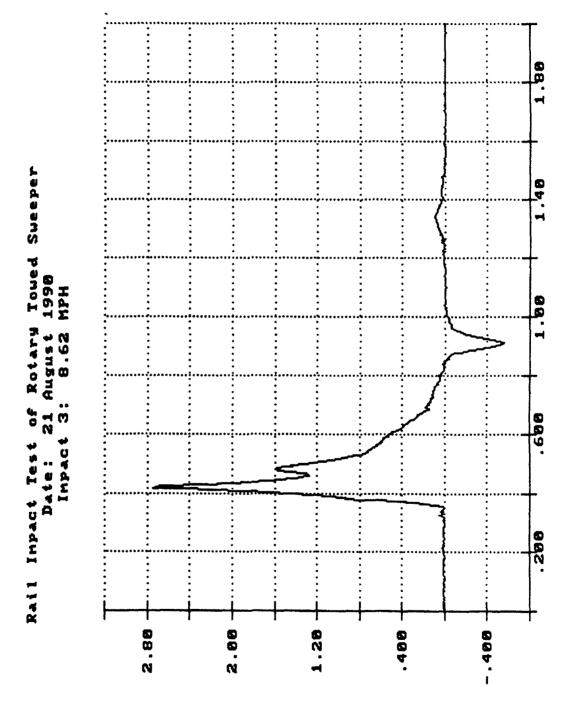

X 1.8888


Sample Time in Seconds

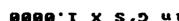


Sample Tine in Seconds

1.8888

×

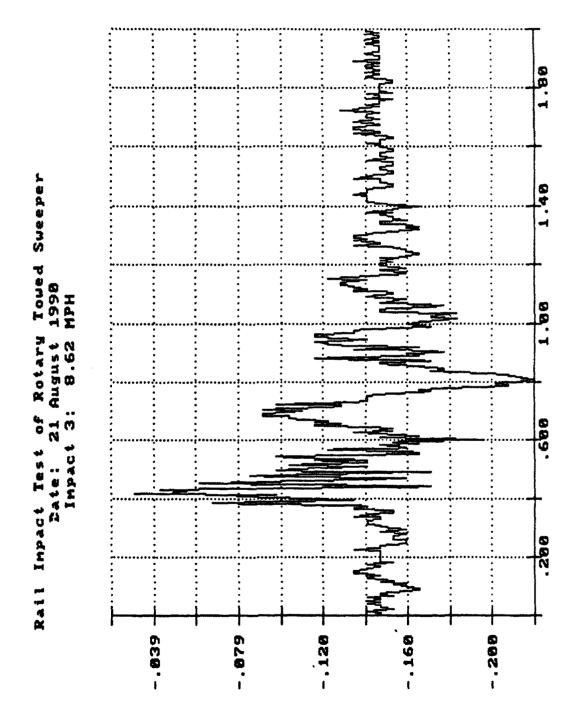

1115 ao

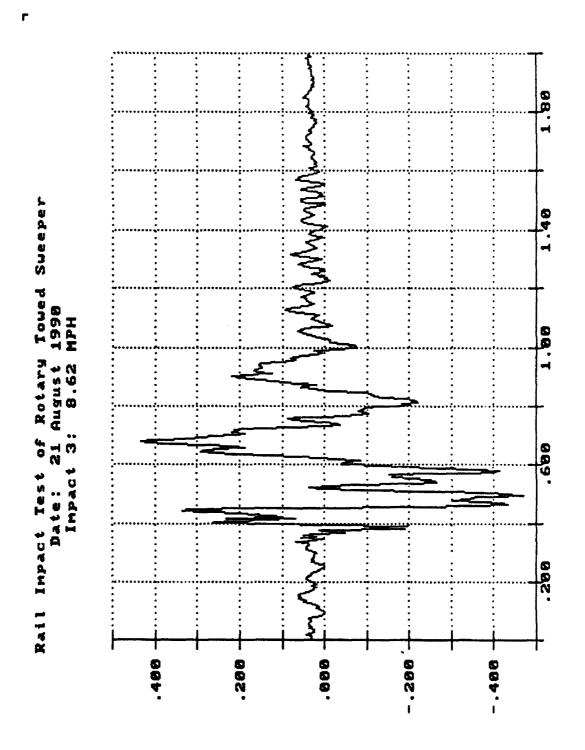


Sanple Time in Seconds

x 1.6688


0000.1 in C'S X

8888.888881 X 2bmuoq mi

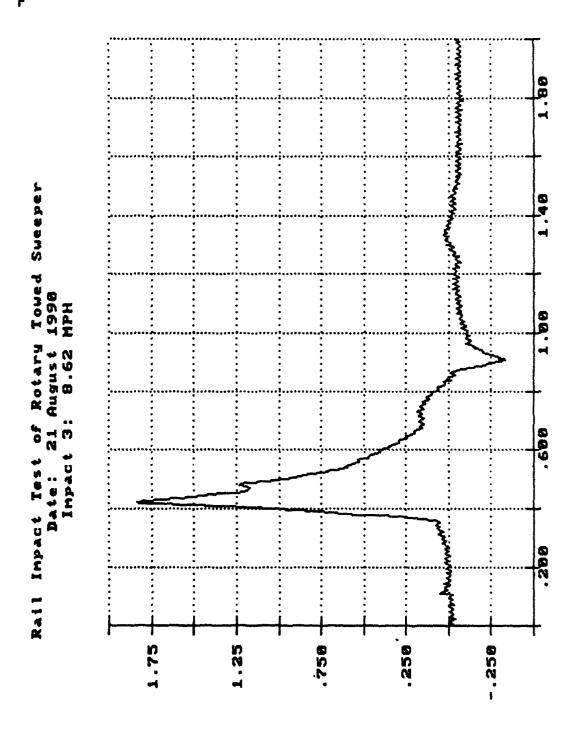

Sample Time in Seconds

6666. X 2.0666

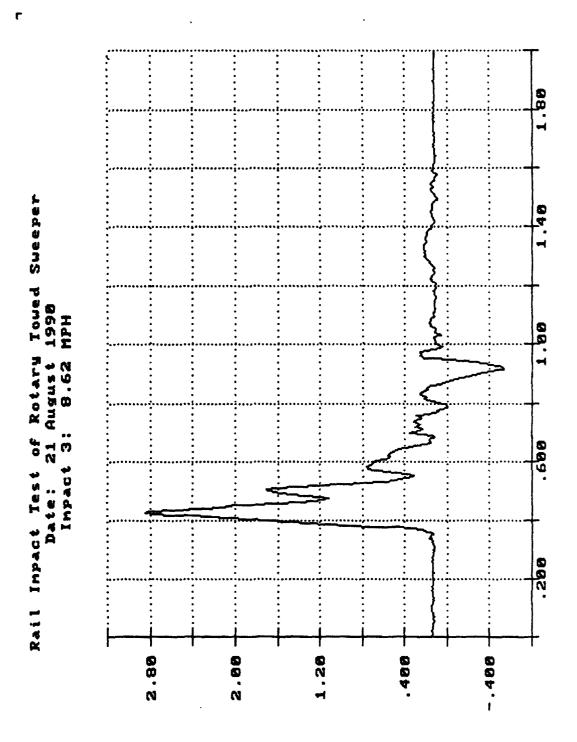


Sample Time in Seconds

1.0000


×

in G'S X 1.0000

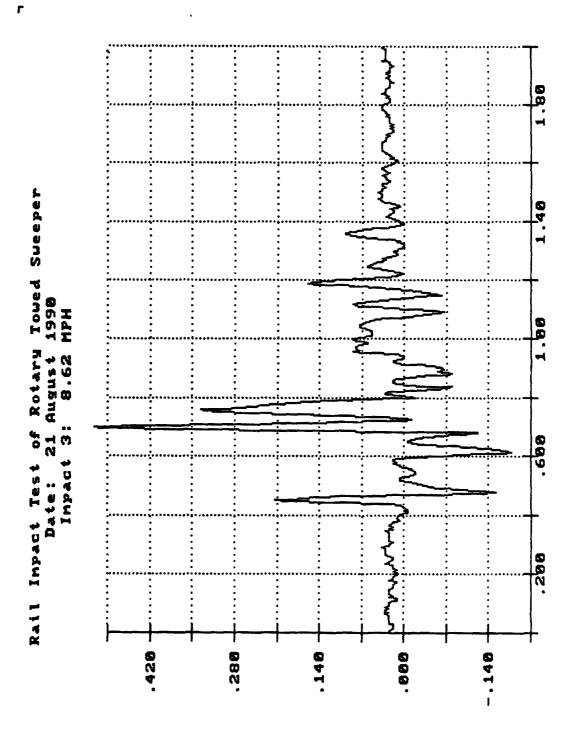


Sample Time in Seconds

6666.1 X 2.0866

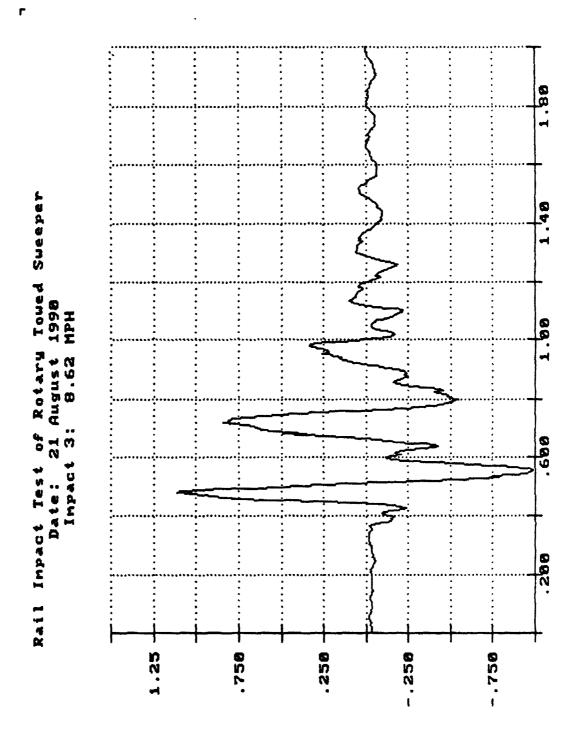

Sample Time in Seconds

in G'S X 1,0000

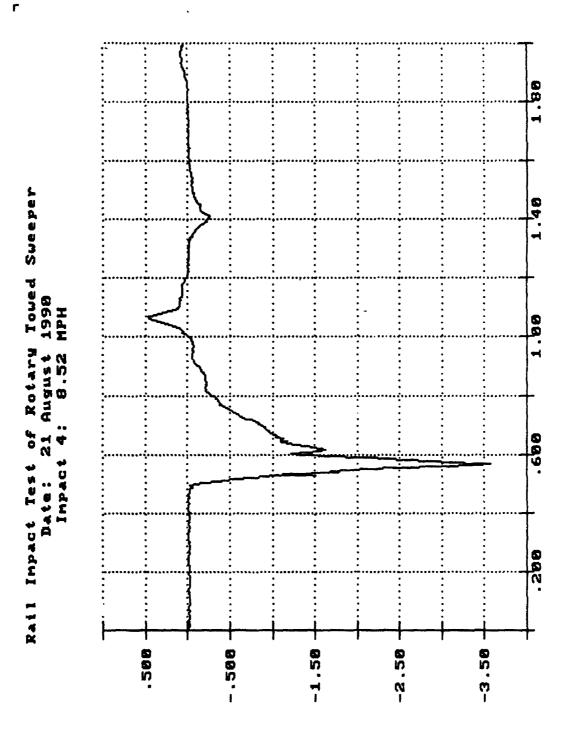

llis uo

Sample Time in Seconds

Towed Sweeper 1990 MPH 1.68 Rotary August : 8.52 Impact Rail Impact Test -.250 .150 . 858 -,858 -,158


Sanple Tine in Seconds

10000 T X S.5 4

Iliz no noitarelecal faratal

in G'S X 1.8888

Uertical Acceleration on Sill

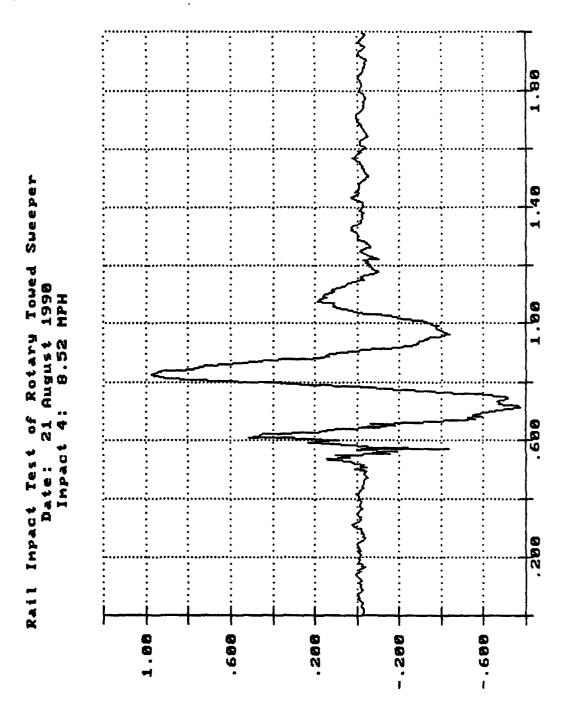


Sample Tine in Seconds

X 1.0000


_

0000.000001 X 2bnuoq ni

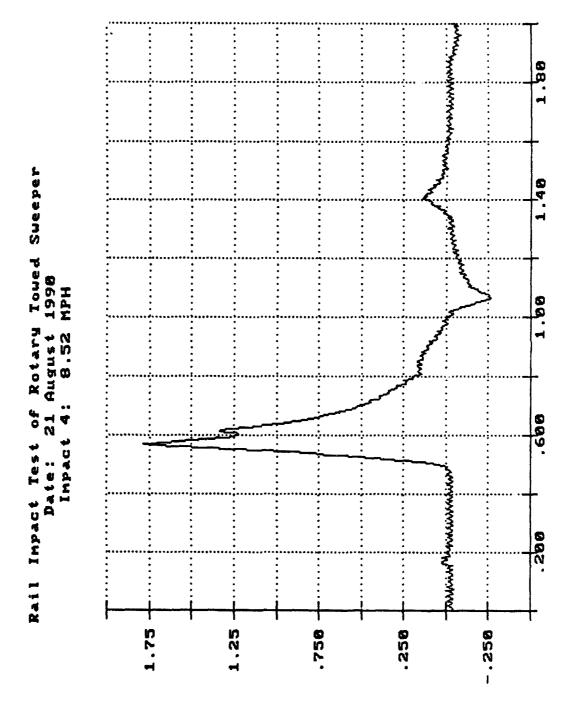


Sample Time in Seconds

X 1,8888

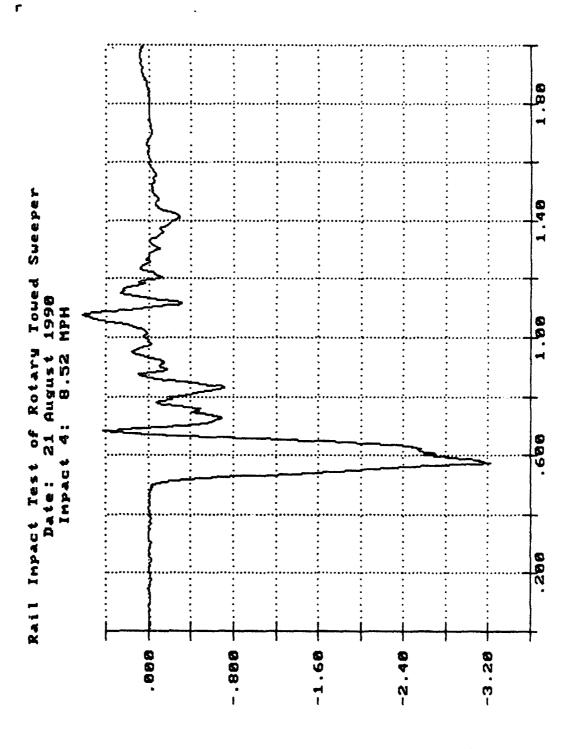


Sample Tine in Seconds

1m G'S X 1.0008

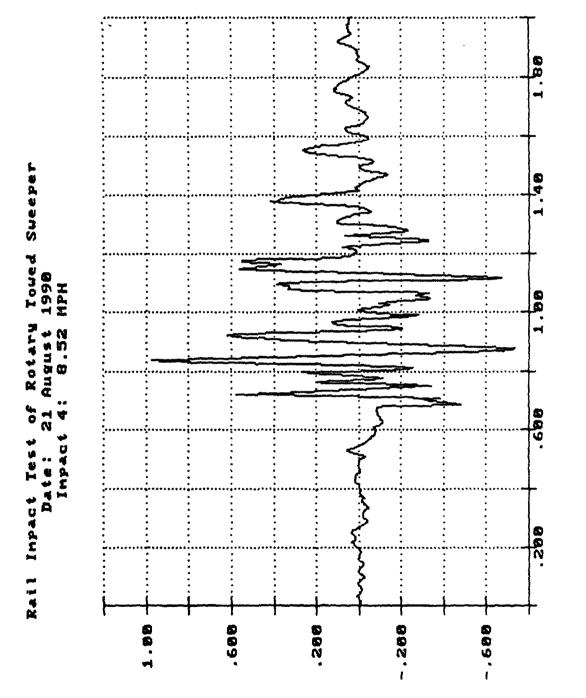

Sample Time in Seconds

Towed Sweeper 1998 MPH of Rotary August : 8.52 Impact 4: 22 Rail Impact Test

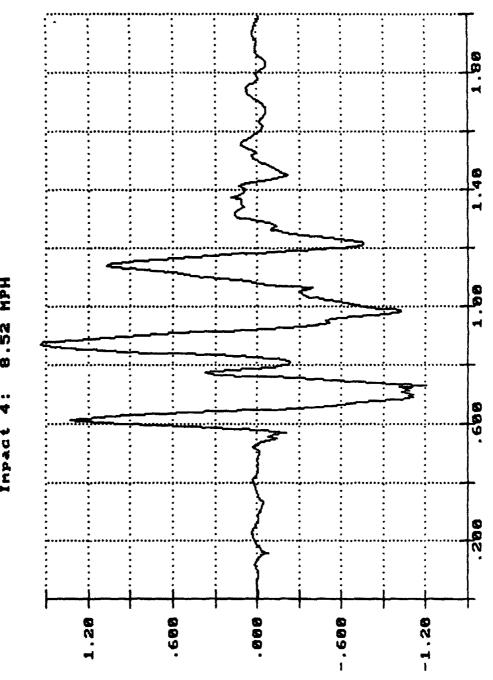

Sample Time in Seconds

x 1.0000

u j